
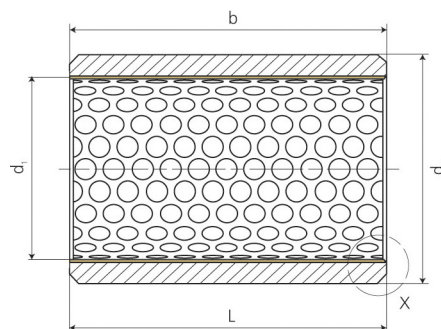


CASQUILHOS METÁLICOS PAP P20

PROGRAMA DE FABRICO

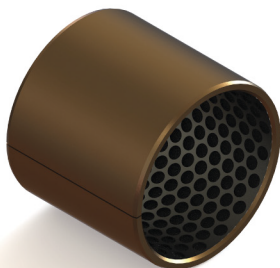

PAP - P20

d= Ø int.	Referência	Peso g	Medidas					
			d ₁	d ₂	b _{±0,25}	f ₁ ⁽¹⁾	f ₂ ⁽¹⁾	d ₇
8	PAP 0808 P20	1.6	8	10	8	0.6	0.3	- ⁽²⁾
8	PAP 0810 P20	2	8	10	10	0.6	0.3	- ⁽²⁾
8	PAP 0812 P20	2.4	8	10	12	0.6	0.3	- ⁽²⁾
10	PAP 1008 P20	1.8	10	12	8	0.6	0.3	- ⁽²⁾
10	PAP 1010 P20	2.3	10	12	10	0.6	0.3	3
10	PAP 1015 P20	3.5	10	12	15	0.6	0.3	3
12	PAP 1210 P20	3	12	14	10	0.6	0.3	3
12	PAP 1212 P20	3.5	12	14	12	0.6	0.3	3
12	PAP 1215 P20	4.4	12	14	15	0.6	0.3	3
12	PAP 1220 P20	6	12	14	20	0.6	0.3	3
14	PAP 1420 P20	6.7	14	16	20	0.6	0.3	3
15	PAP 1510 P20	3.5	15	17	10	0.6	0.3	3
15	PAP 1515 P20	5.3	15	17	15	0.6	0.3	3
15	PAP 1525 P20	8.8	15	17	25	0.6	0.3	3
16	PAP 1612 P20	4.5	16	18	12	0.6	0.3	3
16	PAP 1615 P20	5.6	16	18	15	0.6	0.3	3
16	PAP 1620 P20	7.5	16	18	20	0.6	0.3	3
18	PAP 1815 P20	6.3	18	20	15	0.6	0.3	3
18	PAP 1820 P20	8.5	18	20	20	0.6	0.3	3
20	PAP 2015 P20	10.5	20	23	15	0.6	0.4	3
20	PAP 2020 P20	14	20	23	20	0.6	0.4	3
20	PAP 2025 P20	17.5	20	23	25	0.6	0.4	3
20	PAP 2030 P20	23	20	23	30	0.6	0.4	3
22	PAP 2220 P20	15.4	22	25	20	0.6	0.4	3
25	PAP 2515 P20	14.2	25	28	15	0.6	0.4	4
25	PAP 2520 P20	19	25	28	20	0.6	0.4	4
25	PAP 2525 P20	22	25	28	25	0.6	0.4	4
25	PAP 2530 P20	26.4	25	28	30	0.6	0.4	4
28	PAP 2830 P20	40	28	32	30	1.2	0.4	4
30	PAP 3020 P20	28.6	30	34	20	1.2	0.4	4
30	PAP 3025 P20	35.8	30	34	25	1.2	0.4	4

d= Ø int.	Referência	Peso g	Medidas					
			d ₁	d ₂	b _{±0,25}	f ₁ ⁽¹⁾	f ₂ ⁽¹⁾	d ₇
30	PAP 3030 P20	42.9	30	34	30	1.2	0.4	4
30	PAP 3040 P20	57	30	34	40	1.2	0.4	4
32	PAP 3230 P20	48	32	36	30	1.2	0.4	4
35	PAP 3520 P20	33	35	39	20	1.2	0.4	4
35	PAP 3530 P20	49	35	39	30	1.2	0.4	4
35	PAP 3550 P20	88	35	39	50	1.2	0.4	4
40	PAP 4020 P20	37	40	44	20	1.2	0.4	4
40	PAP 4030 P20	56	40	44	30	1.2	0.4	4
40	PAP 4040 P20	75	40	44	40	1.2	0.4	4
40	PAP 4050 P20	93	40	44	50	1.2	0.4	4
45	PAP 4550 P20	133	45	50	50	1.8	0.6	5
50	PAP 5025 P20	78	50	55	25	1.8	0.6	5
50	PAP 5040 P20	118	50	55	40	1.8	0.6	5
50	PAP 5060 P20	176	50	55	60	1.8	0.6	5
55	PAP 5540 P20	137	55	60	40	1.8	0.6	5
60	PAP 6030 P20	104	60	65	30	1.8	0.6	6
60	PAP 6040 P20	139	60	65	40	1.8	0.6	6
60	PAP 6060 P20	209	60	65	60	1.8	0.6	6
70	PAP 7040 P20	173	70	75	40	1.8	0.6	6
70	PAP 7050 P20	202	70	75	50	1.8	0.6	6
70	PAP 7070 P20	303	70	75	70	1.8	0.6	6
75	PAP 7540 P20	184	75	80	40	1.8	0.6	6
75	PAP 7580 P20	370	75	80	80	1.8	0.6	6
80	PAP 8040 P20	184	80	85	40	1.8	0.6	6
80	PAP 8055 P20	271	80	85	55	1.8	0.6	6
80	PAP 8060 P20	276	80	85	60	1.8	0.6	6
80	PAP 8080 P20	394	80	85	80	1.8	0.6	6
90	PAP 9060 P20	310	90	95	60	1.8	0.6	6
100	PAP 10050 P20	285	100	105	50	1.8	0.6	8
100	PAP 10060 P20	343	100	105	60	1.8	0.6	8